

WOOD DESTROYING PESTS AND ORGANISMS INSPECTION REPORT

Building #, Street, City, State, Zip 410 Mayellen Avenue, San Jose, CA 95126	Date of Inspection 1/25/2023	# Pages 11
--	--	----------------------



ANTIQUE TERMITE, INC.
 1913 Stone Avenue, San Jose, CA 95125
 Phone: (408) 995-6300 Email: info@antiquetermite.com

PR 1187

Report #: 65483

Ordered By: Sandy Kay Kownacki Keller Williams Bay Area Estates 12312 Saratoga Sunnyvale Road Saratoga, CA 95070	Property Owner/Party of Interest: Sean Headrick	Report Sent To:
--	---	-----------------

COMPLETE REPORT
 LIMITED REPORT
 SUPPLEMENTAL REPORT
 REINSPECTION REPORT


General Description: ONE STORY SINGLE FAMILY DWELLING WITH WOOD FRAME AND STUCCO EXTERIOR.	Inspection Tag Posted: GARAGE
	Other Tag(s) Posted:

An inspection has been made to the structure(s) shown on the diagram in accordance with the Structural Pest Control Act. Detached porches, detached steps, detached decks and any other structures not on the diagram were not inspected.

Subterranean Termites
 Drywood Termites
 Fungus/Dryrot
 Other Findings
 Further Inspection

If any of above boxes are checked it indicates that there were visible problems in accessible areas. Read the report for details on checked items.

DIAGRAM NOT TO SCALE

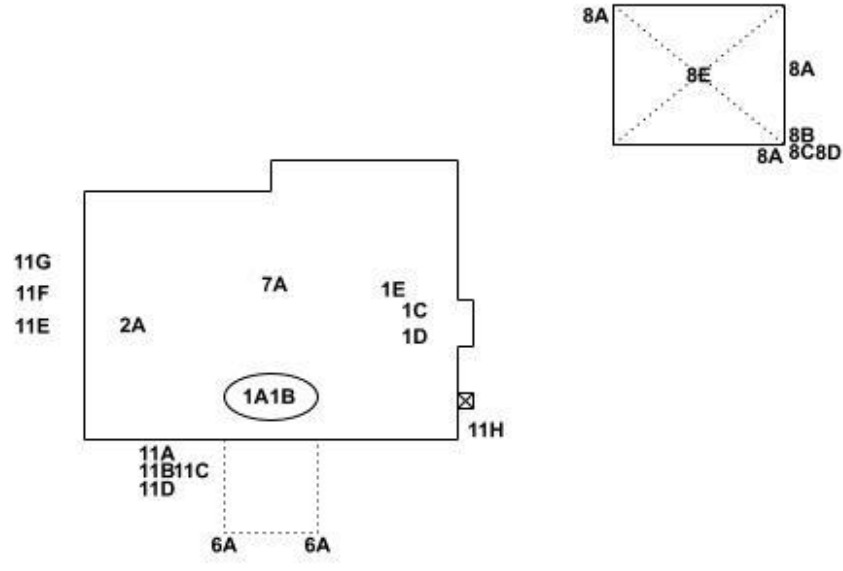

Inspected by: Luis Rodriguez State License #: FR38503 Signature: *L. Rodriguez*

You are entitled to obtain copies of all reports and completion notices on this property reported to the Structural Pest Control Board during the preceding two years. To obtain copies contact: Structural Pest Control Board, 2005 Evergreen Street, Suite 1500, Sacramento, CA 95815.
 NOTE: Questions or problems concerning the above report should be directed to the manager of the company. Unresolved questions or problems with services performed may be directed to the Structural Pest Control Board at (916) 561-8708, (800) 737-8188 or www.pestboard.ca.gov.
 43M-41 (REV. 04/2015)



ANTIQUE TERMITE, INC.

Address: 1913 Stone Avenue, San Jose, CA 95125

Phone: (408) 995-6300

Email: info@antiquetermite.com

Building #, Street, City, State, Zip 410 Mayellen Avenue, San Jose, CA 95126	Date of Inspection 1/25/2023	Report # 65483
--	--	--------------------------

AREAS NOT INSPECTED: The interior of hollow walls, areas beneath and behind built in cabinets were not inspected since inspection of these areas are considered impractical. We did not water test and do not certify against leakage of any appliances, plumbing over finished ceilings, roof coverings, or decks. Such actions were not performed as they are considered impractical without specific written authorization. Floors which are carpeted makes inspection of the flooring in these areas impractical. Soffitted (enclosed framing) areas of the structure makes inspection of interior framing inaccessible for inspection. We make no guarantee against infestations, leaks or adverse conditions which may exist in such areas not inspected. Attached and/or detached fences were not inspected unless otherwise stated in the body of this report. Further inspection is recommended. Further inspection of any inaccessible area and/or area not inspected would be performed upon request at an additional charge (with written authorization). This property was not inspected for the presence or absence of health related molds or fungi. By California Law we are neither qualified, authorized, nor licensed to inspect for health related molds or fungi. If you desire information about the presence or absence of health related molds, you should contact an industrial hygienist.

No furniture or appliances were moved or removed, limiting this inspection to the visible and accessible areas of the above structure shown on the diagram. No statements can be made regarding conditions in closed walls, floors beneath coverings, areas below or behind appliances and built-in cabinet work, stall showers over finished ceilings, such structural segments as porte cocheres, enclosed bay windows, buttresses and similar areas to which there is no access without defacing or tearing out lumber, masonry or finished work. The exterior surface of the roof was not inspected. If interested parties want water tightness of the roof determined, they should contact a roofing contractor who is licensed by the Contractors State License Board. Antique Termite assumes no responsibility for leaks not evident during the time of this inspection. Our inspectors are not equipped with extension ladders, therefore all buildings will be inspected from the ground level only. All wood members above 10 feet from the ground level would be visually inspected only (no probing, etc). Further inspection of these inaccessible area(s) not inspected is recommended and will be performed upon request and at an additional fee.

REINSPECTIONS: If requested by the person ordering this report, a reinspection of the structure will be performed. This company will reinspect repairs done by others within four (4) months of the date of the original inspection. A charge, if any, can be no greater than the original inspection fee for each reinspection. The reinspection must be done within ten (10) working days of request. The reinspection is a visual inspection and if inspection of concealed areas is desired, inspection of work in progress will be necessary. Any guarantees must be received from parties performing repairs. Antique Termite Inc. does not guarantee work performed by others.

All repairs completed by others must be reinspected by Antique Termite before certification will be issued. The reinspection will only CERTIFY the absence of infestation of infection in the visible and accessible areas. Antique Termite does not guarantee work completed by others, nor does this firm make any statements concerning workmanship of those repairs. Workmanship is only determinable by those paying for or receiving those services. A reinspection of specific items on the report or of any other condition pertaining to this structure can be done at an additional cost of \$150.00 per trip. Any reinspection must be performed within four (4) months of the original inspection report. A REINSPECTION FEE OF \$150.00 IS PAYABLE AT THE TIME OF EACH REINSPECTION.

GUARANTEES: Guarantees on work (labor) performed by Antique Termite Inc. are for one (1) year from the date of completion. Guarantees for local chemical treatments are limited to wood members treated only. Fumigations are guaranteed for three years from the date of completion. Plumbing repairs (parts provided by this firm), vinyl (linoleum/LVP materials), toilet resets or any other measures for the control of moisture (caulkings and grouts etc.) are guaranteed for thirty (30) days. Antique Termite, Inc. assumes no responsibility for water damage if the shower enclosure is not installed immediately. The guarantee on showers and tub units is void if the area is used before 24 hours. If the shower fixtures do not fit the owner must contact other tradesman to have new fixtures installed. If necessary for floor installation, vanities are to be removed and replaced by others. Kitchens and laundry areas also must have appliances removed before installation. An additional fee of \$75.00 per appliance and or furniture will be charged for Antique Termite to remove and/or reinstall. We do not do painting, texturing, staining or wallpapering.

Notice: Reports on this structure prepared by various registered companies should list the same findings (i.e. termite infestations, termite damage, fungus damage, etc.) However, recommendations to correct these findings may vary from company to company. You have a right to seek a second opinion from another company.

WHILE PERFORMING TREATMENTS OR ANY CONSTRUCTION REPAIRS, ANTIQUE TERMITE INC. WILL NOT BE RESPONSIBLE OR LIABLE FOR ANY DAMAGE TO ELECTRICAL OR PLUMBING WHICH MAY BE CONCEALED IN WALLS OR BELOW SLABS. BUILDING PERMITS REGARDING REPAIRS WHICH A BUILDING PERMIT IS REQUIRED, IF IT IS FOUND THAT LOCAL BUILDING CODES REQUIRE ADDITIONAL REPAIRS TO BE PERFORMED, THESE ADDITIONAL REPAIRS WOULD BE AT THE OWNER'S EXPENSE AND SAME WOULD BE OUTLINED A SUPPLEMENTAL REPORT.

TILE OR VINYL SELECTIONS: Bids which are given in report for replacement of ceramic tile or vinyl are based on using standard grade material. Ceramic tile bids are based on standard-square 4" tiles at a cost of \$2.78 per square foot for shower walls or tub shower walls. Ceramic floor tile bids are based on 8x8 tiles at a cost of \$2.75 per square foot. Tile selections can be



ANTIQUE TERMITE, INC.

Address: 1913 Stone Avenue, San Jose, CA 95125

Phone: (408) 995-6300

Email: info@antiquetermite.com

Building #, Street, City, State, Zip 410 Mayellen Avenue, San Jose, CA 95126	Date of Inspection 1/25/2023	Report # 65483
--	--	--------------------------

made at Daltile (408-435-1566) 200 E. Trimble Road #50, San Jose, CA 95131. Vinyl plank flooring (LVP) bids are based at a cost of \$3.99 per square foot. Linoleum bids are based on using standard grade linoleum at a cost of \$2.99 per square foot. Vinyl/linoleum selections can be made at S&G Carpet (408-414-1188) 1830 Hillsdale Avenue, San Jose, CA 95124. Tile/vinyl/linoleum selections must be made at least 5 days prior to scheduled repairs. Any upgrades must be paid by the client at the time of selection. If NO selection is made prior to repairs, standard/neutral color tile or sheet vinyl will be installed.

MOLD POLICY STATEMENT: Molds, sometimes called mildew, are not wood destroying organisms. Branch 3 licensees do not have a duty under the Structural Pest Control Act and related regulations to classify molds as harmful to human health or not harmful to human health. This does not modify the Structural Pest Control Act or related regulations.

SECONDARY RECOMMENDATION (SUB STANDARD): Anytime a secondary recommendation (local treatment) is recommended, we must state who requested this secondary recommendation. Secondary recommendations are considered substandard recommendations and guarantees are limited to treated areas only as stated in the report.

Addendum to Contract: Due to recent changes in the law, we are required to give you the following notice. If our inspection report contains a recommendation for lethal gas fumigation, this company subcontracts lethal gas fumigation to: Cost Less Fumigation Inc. (408) 918-9100 or NorCal Fumigation (408) 320-2158.

Notice: The charge for service that this company subcontracts to another registered company may include the company's charges for arranging and administering such services that are in addition to the direct costs associated with paying the subcontractor. You may accept Antique Termite Inc.'s bid or you may contract directly with another registered company. Antique Termite Inc. will not be responsible for any act or omission in the performance of work that you directly contract with another to perform. By signing the attached contract, you authorize Antique Termite Inc. to subcontract this fumigation to a registered fumigation company.

WORK DONE BY OTHERS: Antique Termite, Inc. does not guarantee work performed by others. Such guarantees should be obtained from those performing the repairs. Antique Termite, Inc. only certifies the absence of infestation or infection in the visible and accessible areas. If it is found that others have concealed or hidden infestations or infections during the course of their repairs, it will be the responsibility of interested parties to pursue the responsible party. Antique Termite, Inc. does not inspect for or comment on workman-like manner on repairs done by others. Interested parties must satisfy themselves with the proper permits and licenses and to the quality or appearance of work which is not completed by our company.

INACCESSIBLE AREAS: During the course of repairs as outlined in this report, **IF damage and/or infestation is found to extend into previously inaccessible areas, a supplemental report will be issued outlining findings and costs for any additional repairs or treatments. Antique Termite Inc. does not do any texturing, painting or wallpapering.**

THIS IS A SEPARATED REPORT WHICH IS DEFINED AS SECTION I, SECTION II AND UNKNOWN FURTHER INSPECTIONS CONDITIONS EVIDENT ON THE DATE OF INSPECTION.

- SECTION I: Contain items where there is evidence of active infestations, infections, or conditions which have resulted in or from infestations or infection.
- SECTION II: Are conditions deemed likely to lead to infestation or infection, but where there is no visible evidence of such found.
- UNKNOWN FURTHER INSPECTION (F/I): Recommendations to inspect areas which during the original inspection did not allow the inspector access to complete the inspection and cannot be defined as Section I or Section II.



ANTIQUE TERMITE, INC.

Address: 1913 Stone Avenue, San Jose, CA 95125

Phone: (408) 995-6300

Email: info@antiquetermite.com

Building #, Street, City, State, Zip 410 Mayellen Avenue, San Jose, CA 95126	Date of Inspection 1/25/2023	Report # 65483
--	--	--------------------------

[1 - Subarea]

[ITEM 1A SECTION II PREVENTATIVE \$350.00]

FINDING: Earth contact was noted at the cellulose debris (wood scraps, cardboard, etc.) in the subarea.

RECOMMENDATION: Remove all cellulose debris of a rakeable size or larger.

[ITEM 1B UNKNOWN F/I \$195.00]

FINDING: A portion of the subarea is inaccessible for inspection due to clearance.

RECOMMENDATION: Further inspection is recommended. Owner to contact other trades to make this area accessible after which we will return to the property, perform a further inspection, and issue a supplemental report on any findings.

NOTE: Our bid (if given) at this time is for the further inspection only.

[ITEM 1C SECTION I TREATMENT \$710.00]

FINDING: Subterranean termites were noted coming up from the soil in the area indicated on the diagram.

RECOMMENDATION: Rod and treat the soil in this area with a registered termiticide for the control of subterranean termites.

NOTE: Chemical to be used - Termidor-HE (Fipronil).

NOTE: Our guarantee for this treatment is limited to the treated area(s) only.

[ITEM 1D SECTION I REMOVE TUBES \$210.00]

FINDING: Evidence of subterranean termites (tubes) was noted as outlined in an item above.

RECOMMENDATION: In conjunction with the Structural Pest Control Board, remove all accessible subterranean termite tubes in this area.

[ITEM 1E SECTION II PREVENTATIVE OTHERS]

FINDING: Minor vertical cracks were noted at the foundation. These cracks could lead to moisture intrusion and/or infestation by subterranean termites.

RECOMMENDATION: Engage the services of the appropriate, licensed tradesperson to check this condition and make any necessary recommendations and repairs.

[2 - Showers]

[ITEM 2A NOTE]

NOTE: The hall bathroom shower was water tested at the time of this inspection. No leaks were detected at this time.



ANTIQUE TERMITE, INC.

Address: 1913 Stone Avenue, San Jose, CA 95125

Phone: (408) 995-6300

Email: info@antiquetermite.com

Building #, Street, City, State, Zip 410 Mayellen Avenue, San Jose, CA 95126	Date of Inspection 1/25/2023	Report # 65483
---	---------------------------------	-------------------

[6 - Abutments]

[ITEM 6A UNKNOWN F/I BID ON REQ]

FINDING: There are hollow abutments and/or columns at the approximate location(s) indicated on the diagram. The framing inside this area(s) is inaccessible for inspection.

RECOMMENDATION: Further inspection recommended. If so desired, upon request we would open the inaccessible areas and perform further inspection. Any additional findings would be listed on a supplemental report.

NOTE: Our bid (if given) is for opening the inaccessible area(s) only, any repairs or closing the areas opened would be an additional charge.

[7 - Attics]

[ITEM 7A SECTION II PREVENTATIVE OTHERS]

FINDING: Water stains were noted to the wood members of the attic indicating past or present roof leaks.

RECOMMENDATION: Owners to engage the services of a licensed roofer to survey and make necessary repairs to correct this condition.

[8 - Garages]

[ITEM 8A SECTION I WOOD REPAIR \$1450.00]

FINDING: Fungus damage was noted to the T1-11 siding in the areas indicated on the diagram.

RECOMMENDATION: Cut out these damaged sections and Z-Bar in new material. Owner to contact other trades to paint.

[ITEM 8B SECTION I WOOD REPAIR \$710.00]

FINDING: Rot damage was noted to the fascia boards in the area indicated on the diagram.

RECOMMENDATION: Remove and replace the damaged fascia boards. If damage extends further or into inaccessible areas, a supplemental report will be issued as to the findings and additional repair costs. Owner to contact other trades to paint.

[ITEM 8C SECTION I WOOD REPAIR \$590.00]

FINDING: Fungus damage was noted at the roof eaves at the approximate location(s) indicated on the diagram.

RECOMMENDATION: Remove the roof covering where necessary. Remove the visibly damaged wood members and check for concealed damage/adverse conditions. If no additional findings are made, install new materials where removed. Owner to contact other trades to paint.

NOTE: If any additional findings are made, a supplemental report will be filed with additional bids for repair.

NOTE: Our repairs will be made with commonly available building materials. The size and pattern matches will be approximated based on current lumber sizes. An exact match of the existing materials on structures over 30 years



ANTIQUE TERMITE, INC.

Address: 1913 Stone Avenue, San Jose, CA 95125

Phone: (408) 995-6300

Email: info@antiquetermite.com

Building #, Street, City, State, Zip 410 Mayellen Avenue, San Jose, CA 95126	Date of Inspection 1/25/2023	Report # 65483
--	--	--------------------------

old is not guaranteed.

NOTE: The owner should contract with a licensed roofer to replace the roof covering (where removed) upon completion of this repair.

[ITEM 8D SECTION I ROOFER OTHERS]

FINDING: Roof coverings will be removed or disturbed in conjunction with repairs for wood destroying organism damage as outlined in item 8C.

RECOMMENDATION: Upon completion of wood repairs as outlined above, owner to contact a licensed roofing contractor to inspect and repair and/or reinstall roof coverings in repaired area and guarantee the water tight condition of roof coverings.

NOTE: Interested parties should be aware that Antique Termite, Inc. will not be responsible for any roof leaks and assumes no liability against future damage which may occur in the event that roof coverings are not re-installed in this area

NOTE: If gutters need to be removed in order to facilitate repairs, owner to have other trades reinstall, repair or install new gutters upon completion of wood repairs

[ITEM 8E UNKNOWN F/I \$195.00]

FINDING: Portions of the garage framing are inaccessible for inspection due to storage and/or free standing cabinets. Interested parties should be aware that Antique Termite, Inc. assumes no responsibility for any inaccessible areas.

RECOMMENDATION: Further inspection is recommended. The owner/occupant is advised to move the storage and/or free standing cabinets. At that time and upon request, we would return, perform further inspection, and issue a supplemental report with any findings.

[11 - Exterior]

[ITEM 11A SECTION I WOOD REPAIR \$490.00]

FINDING: Drywood termite damage was noted to the fascia boards in the area indicated on the diagram.

RECOMMENDATION: Remove and replace the damaged fascia boards. If damage extends further or into inaccessible areas, a supplemental report will be issued as to the findings and additional repair costs. Owner to contact other trades to paint.

[ITEM 11B SECTION I ROOFER OTHERS]

FINDING: Roof coverings will be removed or disturbed in conjunction with repairs for wood destroying organism damage as outlined in item 11A.

RECOMMENDATION: Upon completion of wood repairs as outlined above, owner to contact a licensed roofing contractor to inspect and repair and/or reinstall roof coverings in repaired area and guarantee the water tight condition of roof coverings.

NOTE: Interested parties should be aware that Antique Termite, Inc. will not be responsible for any roof leaks and assumes no liability against future damage which may occur in the event that roof coverings are not re-installed in



ANTIQUE TERMITE, INC.

Address: 1913 Stone Avenue, San Jose, CA 95125

Phone: (408) 995-6300

Email: info@antiquetermite.com

Building #, Street, City, State, Zip 410 Mayellen Avenue, San Jose, CA 95126	Date of Inspection 1/25/2023	Report # 65483
--	--	--------------------------

this area

NOTE: If gutters need to be removed in order to facilitate repairs, owner to have other trades reinstall, repair or install new gutters upon completion of wood repairs

[ITEM 11C SECTION I FUMIGATION \$1725.00]

FINDING: Evidence of infestation by drywood termites was noted at the fascia as outlined in item 11A above. These infestations appear to extend into inaccessible areas.

RECOMMENDATION: Seal up and fumigate the entire structure with a lethal gas (VIKANE/SULFURYL FLUORIDE AND CHLOROPICRIN) for the control of drywood termites in all areas of the structure. Remove the seals for reoccupancy.

NOTE: Antique Termite is not liable for any damage which may occur to roof or plant life during fumigation. Fumigation cannot begin during inclement weather. In the case of rain or strong winds the job may be postponed to a later date. Additional information will be shown on the occupants' fumigation notice which must be signed and returned to the fumigation department before the fumigation date. Structure must be vacated for two nights (one night to fumigate, one night to allow for proper ventilation). All preparation work to get structure ready for fumigation is owner/occupants' responsibility. Should owner desire a fumigation prep company to do the necessary prep-work, they should contact fumigation department--there is a cost for this service, which will be in addition to price for fumigation. FUMIGATION WARRANTY IS FOR THREE YEARS FROM DATE OF COMPLETION.

NOTE: Our bid does not include any prep work. All instructions must be thoroughly read and performed. Failure to complete fumigation prep or failure to return signed papers prior to fumigation date will result in cancellation and/or rescheduling. Specific preparation instructions will be issued once fumigation is ordered.

NOTE: The vines in the front and rear of the structure will be covered by the tent and possibly damaged during the course of fumigation. This quote is limited to the main structure only.

NOTE: If fumigation is prepaid in full prior to fumigation date, discounted cost for fumigation would be \$1625.00.

[ITEM 11D SECTION I MASK PELLETS \$300.00]

FINDING: Evidence of infestation by drywood termites was noted in item 11C (fecal pellets).

RECOMMENDATION: In compliance with the Structural Pest Control Board, remove or mask over all accessible drywood termite evidence (pellets) upon completion of treatments.

[ITEM 11E SECTION II PREVENTATIVE OTHERS]

FINDING: The exterior stucco extends into the soil (base of foundation or slab not exposed). While this may have been a common building/construction practice at the time this structure was built, it can limit the ability of the inspector to detect subterranean termite activity behind the stucco. This type of construction may also inhibit the effectiveness of treatments for subterranean termites (if present) due to the fact that a chemical barrier may not be able to reach the foundation.

RECOMMENDATION: Engage the services of the appropriate, licensed tradesperson to cut off the base of the stucco (leaving an exposed portion of the foundation or slab), while still covering the mudsill.

[ITEM 11F UNKNOWN F/I BID ON REQ]

FINDING: There are enclosed framing soffits at this structure. The interior framing at these areas is inaccessible for



ANTIQUE TERMITE, INC.

Address: 1913 Stone Avenue, San Jose, CA 95125

Phone: (408) 995-6300

Email: info@antiquetermite.com

Building #, Street, City, State, Zip 410 Mayellen Avenue, San Jose, CA 95126	Date of Inspection 1/25/2023	Report # 65483
--	--	--------------------------

inspection.

RECOMMENDATION: Further Inspection is recommended. Open the inaccessible area(s) and perform further inspection.

NOTE: Our bid (if given) is for opening the inaccessible area(s) and performing the further inspection only.

[ITEM 11G NOTE]

NOTE: A visual inspection was performed to areas over 10ft. If interested parties desire any further representation of these areas, contact our office for an appointment and price quote.

[ITEM 11H SECTION I WOOD REPAIR \$310.00]

FINDING: Fungus damage was noted to the 1x4 trim at the subarea vent in the area indicated on the diagram.

RECOMMENDATION: Remove and replace this damaged trim with new material. Owner to contact other trades to paint.

[NOTES]

[CHEMICAL NOTE] Section 8538. (a): 'State law requires that you be given the following information: *CAUTION* PESTICIDES ARE TOXIC CHEMICALS. Structural Pest Control Companies are registered and regulated by the Structural Pest Control Board, and apply pesticides which are registered and approved for use by the California Department of Pesticide Regulation and the United States Environmental Protection Agency. Registration is granted when the state finds that based on existing scientific evidence there are no appreciable risks if proper use conditions are followed or that the risks are outweighed by the benefits. The degree of risk depends upon the degree of exposure, so exposure should be minimized.'

'If within 24 hours following application you experience symptoms similar to common seasonal illness comparable to the flu, contact your physician or poison control center (800-876-4766) and your pest control operator immediately.' (This statement shall be modified to include any other symptoms of overexposure which are not typical of influenza.)'

For further information, contact any of the following:

Antique Termite Inc. (408) 995-6300, for general questions
County Health Dept (408) 918-3400, for health questions
County Agriculture Commissioner (408) 918-4600, for application questions

Structural Pest Control Board
2005 Evergreen Street Ste #1500
Sacramento, CA 95825
(916) 561-8700, for regulatory information

The following list of chemicals may be used by Antique Termite, Inc. in the treatment of the above mentioned property:

Chemical Name	Manufacturer Name	Active Ingredients
<input type="checkbox"/> Cy-Kick	Cy-Kick/Whitmire Micr-Gen	Cyfluthrin
<input type="checkbox"/> Tim-Bor	US Borax & Chemical Corp	Disodium Octaborate Tetrahydrate
<input type="checkbox"/> Termidor-HE	Termidor/BASF	Fipronil:Pyrazole
<input type="checkbox"/> Termidor Foam	Termidor Foam/BASF	Fipronil:Pyrazole
<input type="checkbox"/> Vikane	Dow AgroSciences	Sulfuryl Fluoride

[FUMIGATION NOTICE] Structural fumigants are colorless, odorless, and do not affect paints, finishes, or fabrics. Dishes and utensils can be used without washing. By Federal law and as indicated by the label, the following items must be removed before fumigation with any fumigant. Persons, plants, pets, baby mattresses enveloped with plastic covers. All food and medicines not sealed in glass or metal containers. This includes food in refrigerator and freezers. It is to the responsibility of the occupant to have these items removed.

Soil should be soaked with water at least 12 feet from the foundation outward. This can be done the evening before and may help to protect plants. Vines and shrubs connected to the structure must be freed by the owner with ample space provided to get fumigation tarps behind



ANTIQUE TERMITE, INC.

Address: 1913 Stone Avenue, San Jose, CA 95125

Phone: (408) 995-6300

Email: info@antiquetermite.com

Building #, Street, City, State, Zip 410 Mayellen Avenue, San Jose, CA 95126	Date of Inspection 1/25/2023	Report # 65483
--	--	--------------------------

same. All antennae and roof ornaments must be removed by owner or occupant. All automatic timing devices (sprinklers, lights, etc.) must be disconnected during fumigation. Solar systems must be turned off and drained. Should the owner desire a fumigation prep company to perform the necessary prep-work, please contact our office and we can give you the name and phone number of a company which can perform the necessary prep work for a fee. It is the responsibility of the owner to take care of all necessary prep work. If prep work is not done when fumigation crew arrives, the job will be canceled for that day.

Our crews must fumigate several structures in various locations each day. Therefore, the time that any fumigation is scheduled for must be approximate only. Most fumigations are scheduled for sealing sometime during the first day and opened the next day after proper exposure to the fumigant. The time for ventilation varies and in most cases the building will not be certified for re-occupancy until late afternoon the day after it is opened. The structure must be vacated for approximately 72 hours. The tarps will be put up the date scheduled, removed the following date, aired out, and then declared safe to re-enter the date after the tarps have been removed. A sign will be posted on the front door as to when structure is safe to re-enter. We do not wish to inconvenience you by having you wait for the arrival of fumigation crew. When you decide on a date, make arrangements about the keys and leave with the assurance that your building will be properly fumigated.

The GAS service must be shut off prior to fumigation. The fumigation company will contact PG&E to schedule to have service turned off. It is the owner's responsibility to contact PG&E to come back out to the property to turn the gas service back on and relight pilot lights. Homeowner should contact PG&E at least 4 days in advance to schedule them to come back out. PG&E will not turn service back on unless they are shown the re-entry notice which the fumigation company has posted at the structure stating when it is safe to re-enter. Its mandatory that the owner/agent show this notice to PG&E or they will leave the property and reschedule to come back out to the structure once that notice is made available to them. Electricity will remain on.

The utmost care will be taken during fumigations to avoid any possible roof or plant damage. However, in the case of brittle wood shingles or tiles, there is always the possibility of some breakage. Where climbing plants and vines must be detached from the buildings or trellises removed, damage may be unavoidable. Plants that are too close to the structure to allow proper sandbagging of the tarps may be damaged. We can assume NO responsibility for damage resulting from these conditions.

This building will be fumigated with poisonous gases. All persons and animals MUST vacate the premises when the fumigation crew arrives. Under NO circumstances can anyone enter the structure until the fumigation company's notice is posted giving the time and date for safe re-entry. Fumigation cannot commence without a signed notice 'Occupants Fumigation Notice in fumigators possession which will be sent out once fumigation date has been scheduled and will have any additional notes as to the prep work which must be done prior to the fumigation date by OCCUPANT. Should you have any questions regarding fumigation, please contact our office at (408) 995-6300 or the fumigation company. 'If within 24 hours you experience symptoms of dizziness, headache, nausea, reduced awareness, slowed movement, garbled speech or difficulty in breathing, leave the structure immediately and seek medical attention by contacting your physician or Poison Control Center (800-876-4766) and notify your pest control company. The warning agent, chloropicrin, can cause symptoms of tearing, respiratory distress and vomiting. Entry into the space during fumigation can be fatal'

FACT SHEET FOR VIKANE (SULFURYL FLUORIDE): In the interest of Dow Elanco's commitment to product stewardship, this fact sheet is intended to provide basic information and how it is used. If you have additional questions about Vikane or the procedures described, call the Dow Elanco Customer Information Services at 1-800-352-6776. Sulfuryl Fluoride is a gas and can potentially enter your body through inhalation. Because it is a gas, it does not stay on dry surfaces, therefore, there is no exposure from touching treated surfaces. Regarding nervous system and respiratory irritation, over exposure to high levels of Sulfuryl Fluoride can result in nose and throat irritation and nausea. At high concentrations (such as those used during the fumigation), can cause excess fluid in the lungs, sleepiness, pneumonia, and convulsions. These symptoms would be expected to appear within 8 hours after such exposure. In the unlikely event that you experience these symptoms in a building that has been recently fumigated, you should leave immediately. Consult your physician and call the pest control company to have your building re-tested. Additional studies indicate Sulfuryl Fluoride has not been shown to cause birth defects in pregnant animals exposed under experimental conditions. In addition, current studies have demonstrated there are no mutagenic or genotoxic effects caused by exposure to Sulfuryl Fluoride.

WHY BUILDINGS ARE FUMIGATED: Insects that feed or tunnel into the wood can seriously damage houses, apartments, and other dwellings or structures. Each year termites or other wood destroying insects damage approximately 2 million homes. Depending on the extent or location of the infestation, fumigation is the only total control method proven to eliminate certain infestations of wood destroying insects.

HOW BUILDINGS ARE FUMIGATED: Because Vikane is a gas, prior to fumigation the structure is completely sealed. This serves to contain Vikane in the building so it can penetrate wood thoroughly and eliminate the pests. Depending on the construction of the building, the doors and windows may be sealed with tape and a plastic sheet, or the structure may be covered with a tarp. The building will remain sealed for 4 to 72 hours depending on the specifics of the job. Warning signs are posted around the building-notifying people to keep out. After the tarp is removed, a professional fumigator will aerate the structure by opening the doors and windows. Fans may also be used to clear out the building. Once the building has been thoroughly aerated, the fumigator is required to measure the level of any fumigant remaining in the living space to ensure it is below the established safe re-entry concentration. Your building should not be cleared for re-occupancy until it is safe to enter. The fumigator will post a notice on your building indicating the day and time for re-entry. Structures can be occupied only when the concentration is 5 parts per million or less (this represents a margin of safety - laboratory animals have been exposed to 100 parts per million for 2 weeks with no adverse effects). Because Vikane is a true gas and not a vapor, aeration is rapid. Recent studies demonstrated that in most structures levels are less than 1 part per million within 6 hours of clearing and have no detectable levels of Vikane with 24 hours after the start of Aeration. Sulfuryl Fluoride is a colorless, odorless gas, so a warning agent is added to the building, which causes watery eyes and a scratchy throat. If you experience these symptoms in a structure that has been recently fumigated, you should leave immediately and call the pest control company to have your building re-tested.



ANTIQUE TERMITE, INC.

Address: 1913 Stone Avenue, San Jose, CA 95125

Phone: (408) 995-6300

Email: info@antiquetermite.com

Building #, Street, City, State, Zip 410 Mayellen Avenue, San Jose, CA 95126	Date of Inspection 1/25/2023	Report # 65483
--	--	--------------------------

SAFETY PRECAUTIONS AND HOMEOWNER PREPARATION:

- * Discuss the treatment program in advance with your pest control company so you fully understand what will be done and what you need to do.
- * Carefully follow the instructions you are given about what items you are to remove from your building.
- * If you are interested or concerned, you should ask your fumigation company to show the records of how your building was aerated before it was cleared for re-entry.
- * Call DowElanco Customer Service at 1-800-352-6776 if you need additional information or have questions concerning the product.



ANTIQUE TERMITE, INC.

Address: 1913 Stone Avenue, San Jose, CA 95125

Phone: (408) 995-6300

Email: info@antiquetermite.com

Building #, Street, City, State, Zip 410 Mayellen Avenue, San Jose, CA 95126	Date of Inspection 1/25/2023	Report # 65483
--	--	--------------------------

WORK AUTHORIZATION CONTRACT

Indicate authorized items by marking boxes

<input type="checkbox"/> 1C	SECTION I	TREATMENT	\$710.00
<input type="checkbox"/> 1D	SECTION I	REMOVE TUBES	\$210.00
<input type="checkbox"/> 8A	SECTION I	WOOD REPAIR	\$1450.00
<input type="checkbox"/> 8B	SECTION I	WOOD REPAIR	\$710.00
<input type="checkbox"/> 8C	SECTION I	WOOD REPAIR	\$590.00
<input type="checkbox"/> 11A	SECTION I	WOOD REPAIR	\$490.00
<input type="checkbox"/> 11C	SECTION I	FUMIGATION	\$1725.00
<input type="checkbox"/> 11D	SECTION I	MASK PELLETS	\$300.00
<input type="checkbox"/> 11H	SECTION I	WOOD REPAIR	\$310.00
<input type="checkbox"/> 1A	SECTION II	PREVENTATIVE	\$350.00
<input type="checkbox"/> 1B	UNKNOWN F/I		\$195.00
<input type="checkbox"/> 8E	UNKNOWN F/I		\$195.00
<input type="checkbox"/>	PREPAID FUMIGATION DISCOUNT		-\$100.00

Items Not Bid¹: 1E, 6A, 7A, 8D, 11B, 11E, 11F

TOTAL CHECKED ABOVE: _____ OR

SECTION I TOTAL: \$6495.00 - \$100.00

SECTION II TOTAL: \$350.00

¹ Totals include items bid ONLY; see this list for items bid on request or referred to others

ANTIQUE TERMITE INC. AGREES: 1: To guarantee all repairs completed by this company for one year from date of notice of completion, except for plumbing, grouting, caulking, and re-setting of toilets, which will be guaranteed for (30) days. We assume no responsibility for work performed by others. 2: To be bound to perform this work for the price quoted in our cost breakdown for a period not to exceed (30) days. 3: To use reasonable care in the performance of our work but to assume no responsibility for damage to any hidden pipes, wiring, or other facilities or to any shrubs, plants, or other life.

OWNER OR OWNER'S AGENT AGREES: 1: To pay for services rendered upon notice of completion of work. Properties which are in escrow are to be paid at the close of escrow, not to exceed 60 days from date of notice of completion. **Properties not in escrow or those with no buyer are to be paid within 10 days of notice of completion.** 2: To pay for service charges 1.5% per month or a portion of any month beyond the (30) days after completion of work by our company. 3: Owner grants to Antique Termite, Inc. a security interest in the above described real property to secure payment of the sum for work completed and inspection fee. 4: In case of non-payment by owner/responsible party, reasonable attorney fees & any costs of collection to be paid by owner/responsible party whether suit is filed or not. 5: **Credit card payments: We accept Visa & Mastercard. ANY CREDIT CARD PAYMENTS OVER \$1000 WILL INCUR A 3% PROCESSING SURCHARGE.**

BOTH PARTIES AGREE: 1: If additional damage is discovered by Antique Termite Inc. in the performance of the work, Antique Termite agrees to notify owner or agent of the amount of the damage and the amount of the additional work necessary to be performed at an additional cost as per supplemental report. Should the local building department require additional work to be performed, additional work would be performed at the owner's expense. Same would be outlined in a supplemental report. 2: The above additional work to be performed will not be done without written authorization from owner or owner's agent.

NOTICE TO PROPERTY OWNERS: (Under California Contractors License Law) Provides under the Mechanic's Lien Law any contractor, subcontractor, laborer, supplier or other person who helps to improve your property but is not paid for his work or supplies has a right to enforce a claim against your property. This means that, after a court hearing your property could be sold by the court officer and the proceeds of the sale used to satisfy the indebtedness. This can happen even if you paid your own contractor in full, if the subcontractor, laborer or supplier remains unpaid. To preserve their right to file a claim or lien against your property, certain claimants such as subcontractors or material suppliers are required to provide you with a document entitled "Preliminary Notice". Its purpose is to notify you of persons who may have the right to file a lien against your property if they are not paid.

NOTICE OF COMPLETION: Document is not to be used until all funds due to ANTIQUE TERMITE, INC as outlined above are in escrow and supplied with full authorization for release by all concerned parties. If there is not the total amount and/or there is not authorization for full release by both parties, completion/certification is to be returned to ANTIQUE TERMITE, INC immediately. To use this completion/certification if the above stipulations are not met is to assume direct legal responsibility for the entire amount due to ANTIQUE TERMITE INC.

CHEMICAL SENSITIVITY OR ALLERGIES: (Note to occupant) Does any person to your knowledge living or working at this address have any chemical sensitivities or allergies that Antique Termite should be aware of prior to work? If yes, they should contact their physician concerning occupancy during and after any chemical treatment, if specified herein, prior to signing below.

MOLD DISCLAIMER: There may be health related issues associated with the structural repairs reflected in the inspection report referenced by this Work Authorization Contract. These health issues include but are not limited to the possible release of mold spores during the course of repairs. We are not qualified to and do not render any opinion concerning such health issues or any special precautions. Any questions concerning health issues or any special precautions to be taken prior to or during the course of such repairs should be directed to a Certified Industrial Hygienist before any such repairs are undertaken.

TIME & MATERIAL: For items which are bid at time and material (T&M)--cost is based on \$150.00 per man per hour + cost of materials + 10% unless otherwise stated in report.

WORK DEPOSIT: If the "PREPAID FUMIGATION DISCOUNT" is authorized, the undersigned agrees to pay the fumigation price indicated minus the discount indicated at least two business days prior to their chosen date of fumigation. This discount only applies to the main structure. Regardless of fumigation prepayment, the undersigned is responsible for paying 1/3 of the total authorized price at least two business days prior to their chosen date of work or fumigation.

I have read and understand this work authorization contract, the WDO inspection report it refers to, and the terms outlined above. By signing, I hereby authorize the items/costs indicated to be performed pursuant to the terms outlined above.

Print Name _____ Preferred Date for Work to Commence _____

Phone Number, Email Address, and/or Combo Code _____

X _____ X _____
Antique Termite Signature Date Owner or Agent Signature Date